



OUTDOOR - INDOOR LARGE TERMINAL BOX 2 PORTS

AR-TB-OUT-L-2P

AR-TB-OUT-L-2P



1. DESCRIPTION

The equipment is used as a termination point for the feeder cable to connect with drop cable in FTTx communication network system. The fiber splicing, splitting, distribution can be done in this box, and meanwhile it provides solid protection and management for the FTTx network building

2. FEATURES

- 1. Total enclosed structure, be in nice shape.
- 2. Material is PC+ABS, wet-proof、water-proof、dust-proof、anti-aging, protection level up to IP55。
- 3. Clamping for feeder cable and drop cable, fiber splicing, fixation, storage, distribution...etc all in one.
- 4. Cable, pigtails, patch cords are running through own path without disturbing each other, cassette type SC adaptor installation, easy maintenance.
- 5. Distribution panel can be flipped up, feeder cable can be placed in a cup-joint way, easy for maintenance and installation.
- 6. Cabinet can be installed by the way of wall-mounted or poled-mounted, suitable for both indoor and outdoor uses.

3. SPECIFICATIONS

1. Environmental requirement

Working temperature:-40°C~+85°C Relative humidity:≤85%(+30°C) Atmospheric pressure:70KPa~106Kpa

2. Main technical datasheet

Insertion loss:≤0.2dB UPC return loss:≥50dB APC return loss:≥60dB

Life of insertion and extraction: > 1000 times

3. Thunder-proof technical datasheet

The grounding device is isolated with the cabinet, isolation resistance is less than 2x10 4 M Ω /500V (DC)

 $IR \ge 2 \times 10^4 \, M \, O / 500 V$


The withstand voltage between grounding device and cabinet is no less than 3000V (DC) /min, no puncture, no flashover; U≥3000V





4. CONFIGURATION TABLE

Table 1 Model and configuration

Model	Description	Size (pic 1)	Max Capacity		Installation size (pic 2)	
		A*B*C(mm)	SC	LC	PLC	D*E (mm)
AR-TB-OUT-L-2P	Terminal box	102*167*31	2	4 (2 double LC)	4 (LC)	159*80

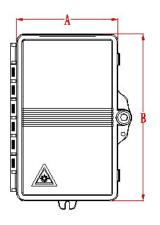




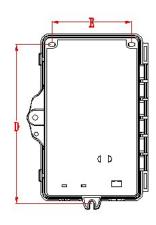

Pic 1 Box Size

Pic 2 Installation Size

5. PRODUCT INSIDE STRUCTURE AND CABLE WAYS

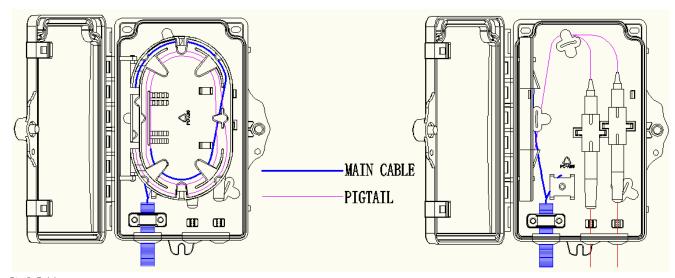


Pic 3 Cable ways

AR-TB-OUT-L-2P



6. INSTALLATION

1. Wall-mounted installation Drill 2 holes over the wall based on the size in table 1, place the expansion bolt Φ 5.5*30, place the box to match up the holes and use bolt to fasten. (Pic 4)

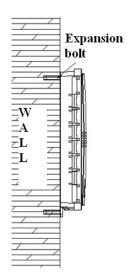

Pic 4 Wall-mounted installation

7. ACCESORIES

- 1. Users' Manual*1
- 2. Key*1
- 3. Accessories Bag * 1